Rapid City ADA Transit	ion Plan Up	odate 2006 DRAFT									
Location	Location Deficiency		Correction		Cr	iteria		Low, N I=High	/I=medium,	Finalized Actions To be completed by	
Facility Name	Area	Barrier	ADAAG Reference	Recommended Correction	Priority (overall)	Public Access	Frequency	Photo #	Conceptual Costs	Finalized Correction	Date To Be Corrected
CSAC, 300 6th St., Rapid City, SD	1st floor	Accessible Approach/Entrance route of travel not marked in front west side	4.3 4.4 4.5 4.7	install proper signage							
		Ramps,slope is 7.0 and cross slope is not flat, landing is 4x4 at every 30 foot horizontal length	4.8	remodel, lengthen, relocate or reconfigure to include switchback							
		ramp railings are 32 1/2"	4.8	adjust and secure handrails in fixtures							
		entrances that are inaccessible do not have signs indicating the location of the nearest accessible entrance	4.14	install signs before inaccessible entrance so that people do not have to retrace the approach							
		east entrance has no handrails, no flat landing - 5.5x1.1	4.13 4.14 4.5	either make west door ADA or remove sign and reroute Community Room traffic to front							
		carpeting/mats are not securely installed to minimize tripping hazards	4.13 4.14 4.5	carpeting or mats must be secured at edges							
		School HR and Adm. Has no signage, handout reach is too high and no handicap counter or stickers	4.3	install proper signage, stickers and lower counter as well as handouts							
		Finance Office handout rack is too high	4.3	lower rack							

pid City ADA Transi	tion Plan U	odate 2006 DRAFT										
Location Deficiency		Deficiency		Correction	Cr	iteria		:Low, N I=High	/I=medium,	Finalized Actions To be completed by		
Facility Name	Area	Barrier	ADAAG Reference	Recommended Correction	Priority (overall)	Public Access	Frequency	Photo #	Conceptual Costs	Finalized Correction	Date To Be Correctec	
		Building & Grounds handicap spaces are not marked	4.3	install proper signs								
		Building & Grounds area does not have a 5 foot circle or T-shaped space for wheelchair to reverse direction	4.3	rearrange furniture, displays or equipment								
		open area under main stairs not detectable	4.2 4.4 4.5	install furnishings, planters or other cane- detectable barriers underneath								
		need more signs/room numbers designating permanent rooms and spaces where goods and services are provided	4.3	install more signs that have raised letters, Grade II Braille and other requirements as noted in 4.1.3(16) and 4.30								
		directional and informational signs are not 3" high with high contrast when mounted 80".	4.3	replace signs as needed to meet the 3" requirements for character size, contract and finish								
		directional and informational signs do not comply with legibility requirements	4.3	review and replace as needed								
		main elevator does not have Braille and raised letters	4.1	add tactile identification								
		public telephones do not have hearing-aid compatibility	4.31	replace phone with a hearing-aid compatible one								

oid City ADA Transit	ion Plan Up	odate 2006 DRAFT									
Location Deficiency		Definition of			Criteria - L=Low,					Finalized Actio To be complete	
		Deficiency	Correction				1	l=High		TO be complete	-
Facility Name	Area	Barrier	ADAAG Reference	Recommended Correction	Priority (overall)	Public Access	Frequency	Photo #	Conceptual Costs	Finalized Correction	Date To Be Correcte
	1st floor men's restroom - West	restroom is available to public but not fully accessible	4.1	reconfigure and remodel							
		stall door is not operable with a closed fist inside and out	4.17	replace handles							
		wheelchair accessible stall does not have a 5x5 clear door swing	4.17	move/remove partitions							
		no grab bars behind or on side wall	4.17	install grab bars							
		toilet seat is too high at 20"	4.17	lower							
		faucets can not be operated with closed fist	4.19	replace with paddle handles							
		bottom edge of mirror reflecting surface is too high at 40 1/2 inches	4.19 4.24	lower mirror to 40" or add additional mirror							
	1st floor women's restroom - West	restroom is available to public but not fully accessible	4.1	reconfigure and remodel							
		stall door is not operable with closed fist	4.17	replace handles							

Ra	oid City ADA Transit	ion Plan Up	odate 2006 DRAFT									
	Location Deficiency			Correction	Cr	iteria		Low, N I=High	/I=medium,	Finalized Actions To be completed by		
	Facility Name	Area	Barrier	ADAAG Reference	Recommended Correction	Priority (overall)	Public Access	Frequency	Photo #	Conceptual Costs	Finalized Correction	Date To Be Corrected
			no wheelchair accessible stall that has area at least 5'x5' clear of door swing	4.17	move or remove partitions							
			an ann an tha branch a status	4.47	Sector Barran and an and barran							
			no rear grab bars in stalls	4.17	install proper grab bars							
			toilet seat is 20"	4.17	must be between 17-19" - lower seat							
			lavatory rim is 35" high		lavatory can not be more than 34" - lower or replace							
			water faucets can not be operated with closed fist	4.19, 4.24	handles must be replaced							
			mirror mount with bottom edge of reflecting surface is 41" high		mirror must be lowerd to 40" or add additional mirror							
		1st floor men's restroom - East										

Rapid City ADA Transiti	on Plan Up	date 2006 DRAFT									
Location		Deficiency		Correction	Criteria - L=Low, H=Hig					Finalized Actions To be completed by	
Facility Name	Area	Barrier	ADAAG Reference	Recommended Correction	Priority (overall)	Public Access	Frequency	Photo #	Conceptual Costs	Finalized Correction	Date To Be Corrected